


WARNING – RISK OF FIRE OR ELECTRIC SHOCK. INSTALLATION REQUIRES KNOWLEDGE OF LUMINAIRES ELECTRICAL SYSTEMS. IF NOT QUALIFIED, DO NOT ATTEMPT INSTALLATION. CONTACT A QUALIFIED ELECTRICIAN.



WARNING – RISK OF FIRE OR ELECTRIC SHOCK. BE CERTAIN ELECTRICAL POWER IS OFF BEFORE AND DURING INSTALLATION OR MAINTENANCE.

WARNING – RISK OF FIRE OR ELECTRIC SHOCK. LUMINAIRE MUST BE CONNECTED TO A WIRING SYSTEM WITH EQUIPMENT-GROUNDING CONNECTOR.


WARNING – RISK OF PERSONAL INJURY DUE TO IMPROPERLY INSTALLED FIXTURE. INSTALL THE LUMINAIRE WITH RECOMMENDED TOOLS AND USE ONLY MATERIAL AND/OR PARTS PROVIDED. WARNING:

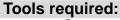



1/2" -13 x 1 ½" Hex Bolt SS (x2)

- 3/8" Split Washer SS (x2)
- 3/8"-16 Hex Nut (x2)

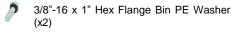





AL Mounting Arm Gasket UPMB Bracket Assembly UPMB Bracket Cover Assembly

Area Light -UPMB Install Instructions


1. Install the Mounting Arm oriented as shown using the provided hardware. Gasket must be placed between the Mounting Arm and the casting to preserve IP rating. Tighten hardware to 12 ft-lbs (144 in-lbs).

2. Install the Mounting Bracket using existing holes. The mounting holes and slots in the Mounting Bracket are designed for $\frac{1}{2}$ " hardware. Tighten hardware to 12 ft-lbs (144 in-lbs).

3. Slide fixture with the Mounting Arm attached down on to the Mounting Bracket, so that the cutout on the Mounting Arm aligns with the Mounting Bracket. The top surfaces of both pieces should be nearly flush.

4. Secure the two halves of the Mounting Bracket fully seating the #10-24 socket head cap screws. Tighten hardware to 4 ft-lbs (50 in-lbs).

5. Complete all wiring according to local and federal standards/regulations . Install cover for Mounting Bracket using the provided #8-32 screws.

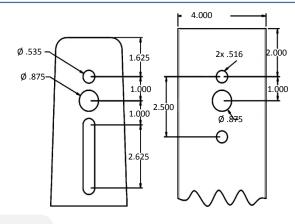

UPMB

UPMB Installer Notes:

1) Pole must be installed in final upright position before installing UPMB bracket and fixture.

Area Light UPMB Kit Installation (Upright Pole Mounting Bracket)

